



CLIENT: Hacker Industries Inc.

1600 Newport Center Drive, Suite 275

Newport Beach, CA 92660

Test Report No: TJ1713-4 Date: March 24, 2014

**SAMPLE ID** 1/8" **SCM-125**.

SAMPLING DETAIL: Test samples were submitted to the laboratory directly by the client. No special sampling

conditions or sample preparation were observed by QAI.

**DATE OF RECEIPT:** Samples were received at QAI on November 15, 2013.

**TESTING PERIOD:** February 28- March 19, 2014.

**AUTHORIZATION:** Signed Work Order by Dean Hacker of Hacker Industries Inc, dated October 28, 2013.

TEST PROCEDURE: ASTM C627-10, Standard Test Method for Evaluating Ceramic Floor Tile Installation

Systems Using the Robinson-Type Floor Tester.

**TEST RESULTS:** Detailed test results are presented in the subsequent pages of this report.

**CONCLUSION:** This product meets the 2013 TNCA Handbook for Ceramic, Glass and Stone Tile

Installation Guidelines for a rating of "Extra Heavy Duty Commercial Application".

**Prepared By** 

Signed for and on behalf of QAI Laboratories, Inc.

Rocky Hale

Materials Testing Technician

Jarred Johnson
Project Manager



Hacker Industries, Inc. Report No.: TJ1713-4 Date: 3/24/2014

Page 2 of 3

## ASTM C627-10, Standard Test Method for Evaluating Ceramic Floor Tile Installation Systems Using the **Robinson-Type Floor Tester**

**Test Procedure:** The two concrete substrates were prepared in accordance with Section 6.1.1 of ASTM C627 and allowed to cure for seven (7) days. The sound barrier identified as 1/8" SCM-125 was applied over the substrates with ANSI approved mortar and covered with a Gypsum Concrete mixture per client specifications. Once cured, the substrates were then prepared according to Section 7, with ANSI A118.4 approved mortar, grout and porcelain tile with a 6" x 6" dimension were applied and allowed to cure for twenty-eight (28) days prior to testing. The grout joint thickness used for installation was 1/4". Upon testing, the appropriate wheels were attached to the machine from the softest to hardest and loaded according to Table 1 of ASTM C627. The machine was ran for a total of 9900 revolutions (14 cycles) for each specimen, with the various wheels and weights, results were recorded and can be seen below in Table 1 and Table 2.

Table 1 - Substrate # 1 Results:

14810 1	- Substrate # 1 Nesults.							
Cycle	Type of Wheels	Total	Duration	Total				
		Weight	of Test	Number of	Damages Noted Per Cycle	Pass/Fail		
		(lbs)	(hrs)	Revolutions				
1	Soft Rubber	300	1	900	No Visible Signs of Damage	PASS		
2	Soft Rubber	600	1	900	No Visible Signs of Damage	PASS		
3	Soft Rubber	900	1	900	No Visible Signs of Damage	PASS		
4	Soft Rubber	900	1	900	No Visible Signs of Damage	PASS		
5	Hard Rubber	300	1	900	No Visible Signs of Damage	PASS		
6	Hard Rubber	600	1	900	No Visible Signs of Damage	PASS		
7	Hard Rubber	900	1	900	No Visible Signs of Damage	PASS		
8	Hard Rubber	900	1	900	No Visible Signs of Damage	PASS		
9	Steel	150	0.5	450	No Visible Signs of Damage	PASS		
10	Steel	300	0.5	450	1 Chipped Tile	PASS		
11	Steel	450	0.5	450	2 Chipped Tile	PASS		
12	Steel	600	0.5	450	2 Chipped Tile	PASS		
13	Steel	750	0.5	450	No Additional Failures	PASS		
14	Steel	900	0.5	450	No Additional Failures	PASS		
			To	tal Damages:	5 Chipped Tiles	PASS		
		Type of	Base Const	ruction:	Concrete Base for Thin-Bed Installations			
	Type of 1	Tile Used and	Type of Mo	ounting:	6" Porcelain Tile, Mortar-Fabric-Mortar Installation			
		Bonding	Medium and	d Grout:	ANSI A118.4 and .11 Approved Mortar and Grout			

Recommendations: Installation shall be considered to have failed to pass any cycle in which the cumulative total number of failures to tile or grout in any one of the following categories exceeds the amount stated: Chipped Tile – 5% of the tile in the wheel path, Broken Tile - 3% of the tile in the wheel path, Loose Tile - 3% of the tile in the wheel path, Popped-Up Grout Joint – 5% of the joints in the wheel path, Cracked Grout Joints – 5% of the joints in the wheel path and Powdered Grout Joints – 5% of the joints in the wheel path.

Observations: Total number of damages included: 5 Chipped Tiles

THIS REPORT IS THE CONFIDENTIAL PROPERTY OF THE CLIENT ADDRESSED. THE REPORT MAY ONLY BE REPRODUCED IN FULL. PUBLICATION OF EXTRACTS FROM THIS REPORT IS NOT PERMITTED WITHOUT WRITTEN APPROVAL FROM QAI. ANY LIABILITY ATTACHED THERETO IS LIMITED TO THE FEE CHARGED FOR THE INDIVIDUAL PROJECT FILE REFERENCED. THE RESULTS OF THIS REPORT PERTAIN ONLY TO THE SPECIFIC SAMPLE(S) EVALUATED.



Hacker Industries, Inc. Report No.: TJ1713-4 Date: 3/24/2014

Page 3 of 3

**Table 1** – Substrate # 2 Results:

Cycle	Type of Wheels	Total	Duration	Total			
		Weight	of Test	Number of	Damages Noted Per Cycle	Pass/Fail	
		(lbs)	(hrs)	Revolutions			
1	Soft Rubber	300	1	900	No Visible Signs of Damage	PASS	
2	Soft Rubber	600	1	900	No Visible Signs of Damage	PASS	
3	Soft Rubber	900	1	900	No Visible Signs of Damage	PASS	
4	Soft Rubber	900	1	900	No Visible Signs of Damage	PASS	
5	Hard Rubber	300	1	900	No Visible Signs of Damage	PASS	
6	Hard Rubber	600	1	900	No Visible Signs of Damage	PASS	
7	Hard Rubber	900	1	900	No Visible Signs of Damage	PASS	
8	Hard Rubber	900	1	900	No Visible Signs of Damage	PASS	
9	Steel	150	0.5	450	No Visible Signs of Damage	PASS	
10	Steel	300	0.5	450	No Visible Signs of Damage	PASS	
11	Steel	450	0.5	450	No Visible Signs of Damage	PASS	
12	Steel	600	0.5	450	No Visible Signs of Damage	PASS	
13	Steel	750	0.5	450	No Visible Signs of Damage	PASS	
14	Steel	900	0.5	450	No Visible Signs of Damage	PASS	
Total Dama					No Visible Signs of Damage	PASS	
Type of Base Construction:					Concrete Base for Thin-Bed Installations		
	Type of	Tile Used and	Type of Mo	ounting:	6" Porcelain Tile, Mortar-Fabric-Mortar Installation		
		Bonding	Medium and	d Grout:	ANSI A118.4 and .11 Approved Mortar and Grout		

Recommendations: Installation shall be considered to have failed to pass any cycle in which the cumulative total number of failures to tile or grout in any one of the following categories exceeds the amount stated: Chipped Tile -5% of the tile in the wheel path, Broken Tile -3% of the tile in the wheel path, Loose Tile -3% of the tile in the wheel path, Popped-Up Grout Joints -5% of the joints in the wheel path and Powdered Grout Joints -5% of the joints in the wheel path.

Observations: Total number of damages included: None

\*\*\* END OF TEST REPORT \*\*\*